

NFPA70E-2009 Tables 130.7(C)(9)&(10) ≤ 600 Volts @ 18 Inches Working Distance PCD-PEM-CD Feb 2009

TASK = VOLTAGE TEST MEASUREMENT		TASK = APPLICATION OF SAFETY GROUNDS AFTER VOLTAGE TEST	
HAZARD RISK CATEGORY			
PPE	2 *	2	1
	FR = Fire Rated ≥ 8 cal/cm ²	FR = Fire Rated ≥ 8 cal/cm ²	FR = Fire Rated ≥ 4 cal/cm ²
Ear	Ear Canal Inserts	Ear Canal Inserts	Ear Canal Inserts
Head	Hard Hat	Hard Hat	Hard Hat
Eye	Safety Glasses or Goggles	Safety Glasses or Goggles	Safety Glasses or Goggles
Face	FR Face Shield & Balaclava or Arc Flash Suit Hood	FR Wrap Around Face Shield or Arc Flash Suit Hood	FR Face Shield or Arc Flash Suit Hood
Hand	V Rated Gloves & Leather Protectors	V Rated Gloves & Leather Protectors	V Rated Gloves & Leather Protectors
Foot	Leather Work Shoes	Leather Work Shoes	Leather Work Shoes As Needed
Torso	FR Long Sleeve Shirt & Long Pants or Coverall	FR Long Sleeve Shirt & Long Pants or Coverall	FR Long Sleeve Shirt & Long Pants or Coverall

NFPA70E-2009 Tables 130.7(C)(9)&(10) ≤ 600 Volts @ 18 Inches Working Distance PCD-PEM-CD Feb 2009

TASK = CIRCUIT BREAKER or FUSED SWITCH OPERATION w/ COVERS ON		TASK = CIRCUIT BREAKER or FUSED SWITCH OPERATION w/ COVERS ON	
HAZARD RISK CATEGORY			
PPE	2	1	0
	FR = Fire Rated ≥ 8 cal/cm ²	FR = Fire Rated ≥ 4 cal/cm ²	NM = Non-Melt Fabric ≥ 4.5 oz/yd
Ear	Ear Canal Inserts	Ear Canal Inserts	Ear Canal Inserts
Head	Hard Hat	Hard Hat	
Eye	Safety Glasses or Goggles	Safety Glasses or Goggles	Safety Glasses or Goggles
Face	FR Wrap Around Face Shield or Arc Flash Suit Hood	FR Face Shield or Arc Flash Suit Hood	
Hand	Leather Gloves	Leather Gloves	Leather Gloves As Needed
Foot	Leather Work Shoes	Leather Work Shoes As Needed	
Torso	FR Long Sleeve Shirt & Long Pants or Coverall	FR Long Sleeve Shirt & Long Pants or Coverall	NM Long Sleeve Shirt & Long Pants